

Features

- Compact Design
- Easy Mounting in Blind Hole or with Optional Screw-On Enclosure
- 0-15 V Supply Voltage Range
- Differential Analog Output
- Available in Several Force Ranges

Application Examples

- Watchmaking Equipment
- Medical Devices
- Measuring and Testing Equipment
- Robotics




Senstech KZ-011-0400

Centered Force Sensor

With this compact force sensor, the force is applied to a round-head rivet in the center. The sensor can be mounted very easily in a blind hole with a diameter of 12 mm and a clearance. Flexible contacting and housing options make this sensor suitable for a wide variety of applications.

Dimensions and Mounting Options

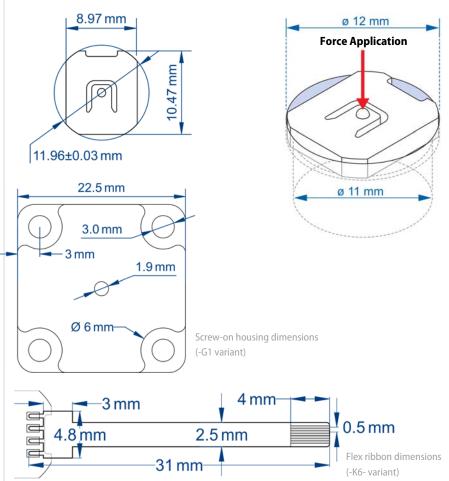

General Specifications

Measuring principle	Thin film strain gauges
Measuring parameter	Force [N] or displacement [µm]
Electrical contacting	Solder points, stranded wires, or flex ribbon
Mounting	Fits into a blind hole of D = 12 mm, with a clearance of 11 mm > d > 6 mm below sensor to allow for measuring path and protect against overload
Application of force	On round carbide rivet head, positioned in center of
Direction of force	Perpendicular on thin-film coated side or back side
Shielding	Sensor substrate is connected to supply ground

Environmental Specifications

	Min	Тур	Max	Units	Notes/Conditions
Temperature range - Operation - Storage	-20 -40		125 125	°C °C	
Ambient humidity	0		95	%RH	Non-condensing
Ingress protection		IP44			Only valid for variant with housing (-G1)

Operating Specifications

	Min	Тур	Max	Units	Notes/Conditions
Supply voltage	0		15	V	
Supply current	1.5		2.5	mA	at 10 V
Output signal span		03.0		mV/V	The output voltage is given by $V_{out} = V_{cc} \cdot F_{sensor} \cdot s$ where V_{out} Output Voltage [μ V] F_{sensor} Force Applied [N] V_{cc} Supply Voltage [V] S Sensitivity [μ V/V/N] - see Ordering Information section
Bridge resistance	4.0		6.0	kΩ	
Zero offset	-0.1		0.1	mV/V	Signal without load, variance between specimens
Zero repeatability	-0.02		0.02	%FS	Variance between measurements (FS = Full Scale)
Sensitivity tolerance	-10		10	%	Variance of sensitivity between specimens
Sensitivity repeatability	-0.3		0.3	%	Variance of sensitivity between measurements
Linearity error	-0.2		0.2	%FS	
Thermal shift for zero	-0.02		0.02	%FS/°C	
Thermal shift for sensitivity	0.02	0.025	0.03	%/°C	

Specifications can be customized in case of larger order quantities. The values listed here often do not represent the best achievable performance.

Variants and Ordering Information

KZ-011-0400-<u>xxxN</u>-<u>Ex</u>-<u>Kx</u>-<u>Gx</u>

Applic	Application of Force		
Code	Force Application Aid		
<u>E0</u>	None (hole only)		
<u>E1</u>	Rivet on top side		
<u>E2</u>	Rivet on bottom side		

Contacting				
Code	Contacting Variant			
<u>K0</u>	Tinned solder pads only			
<u>K1</u>	Stranded wires, 20 cm			
<u>K6</u>	Flex ribbon «Antlia»			

Housing		
Code	Housing Variant	
<u>G0</u>	None	
<u>G1</u>	Screw-on metal housing	

Force Range				
Code	Full Scale	Allowable	Substrate	Sensitivity
	Range	Overload	Thickness	
<u>50N</u>	0 N - 50 N	75 N	0.8 mm	54 μV/V/N
<u>80N</u>	0 N - 80 N	120 N	1.0 mm	37 μV/V/N
<u>200N</u>	0 N - 200 N	300 N	1.6 mm	15 μV/V/N
<u>300N</u>	0 N - 300 N	450 N	2.0 mm	10 μV/V/N

Wire Color Code		
Color	Pin Assignment	
Red	Supply Voltage	
Black	Supply Ground	
Blue	Output Signal +	
White	Output Signal –	